

### Site Visit Report

**Subject: Inspection of MSW dumping site of Nagarpalika- Valsad at Survey no. 152, near Railway Bridge at Auranga River is carried out with reference to HO mail dated 21/09/2023 in the matter of O.A. No. 57/2023 (Old O.A. No. 540/2022) (Prakashbhai Premabhai Patel & Ors. Versus State of Gujarat).**

#### **Status regarding Solid Waste Management of Valsad Nagarpalika:**

- Total population of Valsad Nagarpalika as per census-2011 is 1,15,114 Nos.
- Currently Valsad Nagarpalika is dumping MSW at dumping site Sandhpore at plot no. 152, near Railway Bridge at Auranga River. Valsad Nagarpalika has not developed scientific landfill site for the disposal of MSW.
- Nagarpalika has obtained authorization under MSW rules - 2016 for developing MSW site at plot no. 152, near Railway Bridge at Auranga River which attached as **Annexure A**.
- MSW dumping site is located just adjacent to bank of river Auranga. At present they dispose MSW on open land near STP adjacent to Bank of River Auranga.
- MSW received from residential, commercial, hotels & non-residential area of Nagarpalika area and dumped at bank of Auranga River near railway bridge through tractor, tempo. Nagarpalika has stored waste haphazardly at this site.
- There is no development for fresh waste processing by Valsad Nagarpalika.
- Valsad Nagarpalika has given work order for Legacy waste processing to M/s. Mahavir Enterprise-Bhavnagar on 27/07/2023.
- One Auto Vibrator Screener is observed at MSW dumping site which is found not in operation during inspection. Till date work is not started for processing of Legacy waste.
- No fencing or Boundary wall is constructed on periphery of dumping site. During inspection Animals grazing observed on MSW dumping site & No waste processing is observed.

Photographs taken during visit:







**Written instructions given to Valsad Nagarpalika during visit:**

1. You shall submit Compliance Report with reference to this office letter dated 30/05/2023 with respect to Hon'ble NGT order dated 05/09/2022 in the matter of O.A. No. 540/2022.
2. You shall submit Progress Report of MSW Fresh and Legacy waste processing.
3. You shall comply with SWM Rules-2016.
4. During inspection Animals grazing observed on MSW dumping site & No waste processing is observed.
5. You shall submit work order of Fresh & Legacy waste processing and also submit completion date of Legacy waste processing.

**Visit of Village Bhagad, Dandi, Moti Danti and Nani Danti is carried out along with representative of Valsad Nagarpalika Shri Sanjaybhai Valodra (S.I.), Divyaniben J. Patel, Tanviben R. Tandel. Detail visit report is as follow:**

Sr. No.	Name of Village	Observation
1	Bhagad	<ul style="list-style-type: none"> <li>• <b>Contacted person:</b> <ol style="list-style-type: none"> <li>(1) Shree Divyeshbhai Dodiya – Vahivatdar,</li> <li>(2) Shree Jigneshbhai Patel – Computer Operator.</li> <li>(3) Harsadbhai Sukhabhai Patel- Resident of Village-Bhagad</li> <li>(4) Dipakbhai Thakorbhai Patel- Resident of Village-Bhagad</li> </ol> </li> <li>• Plastic waste is observed on shore line of the village Bhagad. Photographs is attached herewith. Quantity of plastic waste accumulation waste deposition at sea shore line is observed higher compared previous inspection dated 31/12/2022.</li> <li>• In Bhagad, at present there is no facility for solid waste collection, segregation, processing and disposal. At present generated solid waste is dumped and burnt by individuals.</li> </ul>








2	Dandi	<p><b>Contacted person:</b></p> <p>(1) Shree Manishbhai - Vahivatdar</p> <p>(2) Shree Jigneshbhai Patel – Computer Operator</p> <ul style="list-style-type: none"> <li>• Plastic waste is observed on shore line of the village Dandi. Photographs is attached herewith. Quantity of plastic waste accumulation waste deposition at sea shore line is observed higher compared previous inspection dated 31/12/2022.</li> <li>• In Dandi, at present there is no facility for solid waste collection, segregation, processing and disposal. At present generated solid waste is dumped and burnt by individuals.</li> </ul>
---	-------	---





		
3 & 4	<b>Moti Danti &amp; Nani Danti</b>	<ul style="list-style-type: none"> <li>• <b>Contacted person:</b> <ol style="list-style-type: none"> <li>(1) <b>Shree Amratbhai Tandel – Sarpanch of village Moti Danti &amp; Nani Danti</b></li> <li>(2) <b>Shree Arjunbhai Tandel – Depty. Sarpanch of village Moti Danti &amp; Nani Danti</b></li> </ol> </li> <li>• Minor Plastic waste is observed on shore line of the village <b>Moti Danti &amp; Nani Danti</b>. Photographs is attached herewith. Quantity of plastic waste accumulation waste deposition at sea shore line is observed slightly higher compared previous inspection dated 31/12/2022.</li> <li>• In <b>Moti Danti &amp; Nani Danti</b>, at present there is no facility for solid waste collection, segregation, processing and disposal. At present generated solid waste is dumped and burnt by individuals.</li> </ul>







**Moti Danti**







**Nani Danti**

**Conclusion:**

1. Nagarpalika has obtained authorization under MSW rules - 2016 for developing MSW site at plot no. 152, near Railway Bridge at Auranga River.
2. There is no development for fresh waste processing by Valsad Nagarpalika.
3. Valsad Nagarpalika has given work order for Legacy waste processing to M/s. Mahavir Enterprise-Bhavnagar on 27/07/2023.
4. No fencing or Boundary wall is constructed on periphery of dumping site. During inspection Animals grazing observed on MSW dumping site & No waste processing is observed.



5. Nagarpalika has not submitted compliance report with reference to Joint Committee Report dated 31/12/2022 hence instructed to submit the same.
6. Quantity of plastic waste accumulation waste deposition at sea shore line is observed higher compared previous inspection dated 31/12/2022.
7. In Bhagad, Dandi, Moti Danti & Nani Danti, presently there is no facility for solid waste collection, segregation, processing and disposal. At present generated solid waste is dumped and burnt by individuals.


Date: 25/09/2023

Inspecting Team:



Kishan R. Patel

A.P.E.

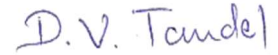

Deval V. Tandel

A.E.E.

## Annexure A



વલસાડ નગરપાલિકા  
વલસાડ  
[np\\_valsad@yahoo.co.in](mailto:np_valsad@yahoo.co.in)  
[www.valsadnagarpalika.org](http://www.valsadnagarpalika.org)

ચીફ ઓફિસર ૨૪૨૭૦૨  
સેનેટરી ૨૪૪૨૬૬  
બાંધકામ શાખા ૨૪૨૬૦૫  
ફાયર શાખા ૨૪૪૨૨૨  
વહીવટી શાખા ૨૪૨૭૦૨

નં. જાવક નંબર : ૨૩૩.  
તા : ૨૯-૦૯-૨૦૨૩

વર્ક ઓર્ડર

પ્રતિ,  
શ્રીમહાવીર એન્ટરપ્રાઇઝ,  
બીજો માળ ૨૦૯/એ, લીલા એફસી  
અક્ષરવાડી પાસે, વાઘાવાડી રોડ  
ભાવનગર - ૩૬૪૦૦૨  
ગુજરાત,

વિષય - : લેગેસી વેસ્ટ નિકાલની કામગીરી કરવા બાબત.  
અનુસંધાન :- આપની એજન્સીનું આવેલ ટેન્ડર આઈ.ડી.નં.-597977

આથી તમોને વર્ક ઓર્ડર આપી જણાવવાનું કે, વહીવટદાર ઠરાવ નં. ૪૩ તા:૧૪/૦૭/૨૦૨૩ થી મંજૂર થયા મુજબ, વલસાડ નગરપાલિકાની ડમ્પિંગ સાઇટના લેગેસી વેસ્ટના નિકાલની કામગીરી કરવા અંગે આપની એજન્સીના પ્રતિ મેટ્રિક ટનના રૂ.૪૫૦/- ભાવ મંજૂર કરવામાં આવેલ છે. જે મંજૂર થયેલ ભાવથી ઉપરોક્ત કામગીરી કરારનામામાં જણાવેલ શરતો (૧) થી (૧૮) ને આધીન રહી પૂર્ણ કરવા તથા તમો દ્વારા લેગેસી વેસ્ટની નિકાલ અંગેની કરેલ કામગીરીનો રોજરોજનો અહેવાલ મારી સમક્ષ રજૂ કરવા તેમજ કરેલ કામગીરીના ફોટોગ્રાફ્સ સહિતના બિલ અત્રેની કચેરીએ રજૂ કરવા નોંધ લેશો.

  
ચીફ ઓફિસર

વલસાડ નગરપાલિકા